







**THE DATASHEET OF**  
**046841039100846+**



**0.3mm Pitch  
SERIES**


# 6841

**0.3mmピッチ ST SMT スライドロック  
0.3mmPitch Vertical SMT Slide lock**

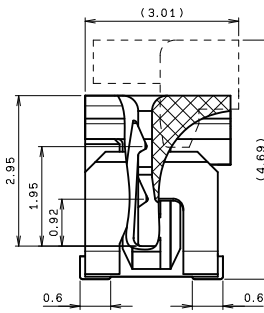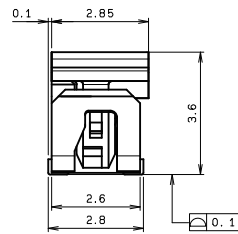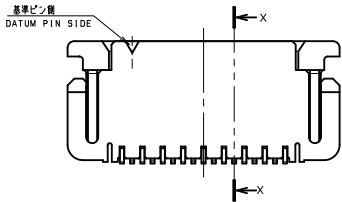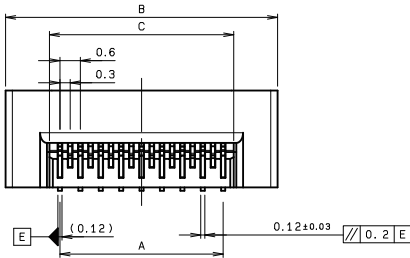


SECT. X-X


極数 NO. OF POS.	A	B	C
15	4.2	7.4	4.86
17	4.8	8.0	5.46
19	5.4	8.6	6.06
21	6.0	9.2	6.66
23	6.6	9.8	7.26
25	7.2	10.4	7.86
27	7.8	11.0	8.46
29	8.4	11.6	9.06
31	9.0	12.2	9.66
33	9.6	12.8	10.26
35	10.2	13.4	10.86
37	10.8	14.0	11.46
39	11.4	14.6	12.06
41	12.0	15.2	12.66
43	12.6	15.8	13.26
45	13.2	16.4	13.86
47	13.8	17.0	14.46
49	14.4	17.6	15.06
51	15.0	18.2	15.66

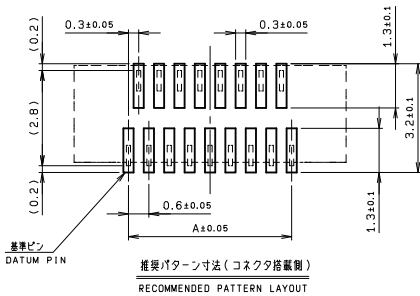


推奨パターン寸法 (コネクタ搭載側)  
RECOMMENDED PATTERN LAYOUT

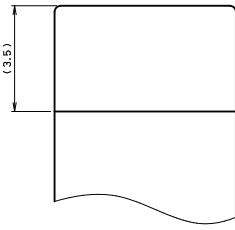

支持テープ  
SUPPORTING TAPE  
適用FPC寸法  
APPLICABLE FPC

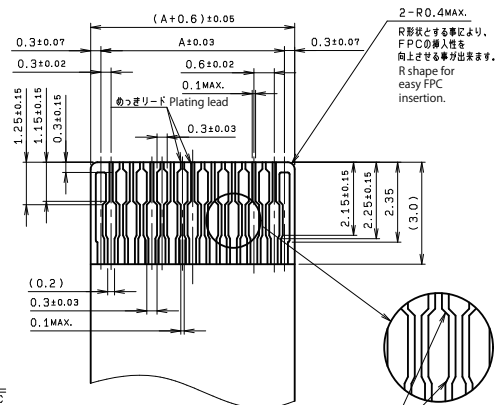


テーパ部をオーバーラップさせる事により、屈曲時の断線が発生しにくくなります。  
For prevention against an open circuit in being bent, the tapered areas shall be laid out as indicated.

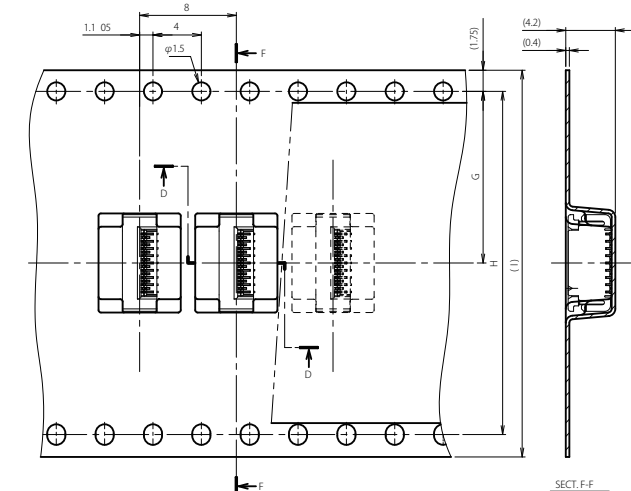

SECT. F-F

極数 NO. OF POS.	G	H	I
15	7.5	—	16.0
17	7.5	—	16.0
19	11.5	—	24.0
21	—	—	—
23	—	—	—
25	—	—	—
27	—	—	—
29	—	—	—
31	—	—	—
33	—	—	—
35	—	—	—
37	—	—	—
39	—	—	—
41	—	—	—
43	—	—	—
45	11.5	—	24.0
47	14.2	28.4	32.0
49	14.2	28.4	32.0
51	14.2	28.4	32.0



SECT. D-D

注文コード ORDERING CODE  
**04 6841 0XX X00 846+**

RoHS 対応品  
RoHS Compliant Product

金めっき Au plated

エンボス仕様 Tape&Reel

1: 標準品 (メカチャック対応) Standard (Able to Mechanical chucking)

0: 吸着専用 Vacuum only type

極数 NUMBER OF POSITIONS

生産対応可能極数については、営業部にご確認願います。

Feel free to contact our sales department for available numbers of positions.







梱包数量 2000個/リール  
PACKING QUANTITY : 2000 /Reel

## Looking for pricing, stock, or lifecycle information?

Click below to explore more details on WIN SOURCE:

-  [View 046841039100846+ on WIN SOURCE](#)
-  [AVX Corp/Kyocera Corp](#) Information

## Optimize Your Supply Chain with WIN SOURCE Solutions

-  Global Sourcing Solution
-  Obsolete Management
-  Cost Control Management
-  Shortage Management
-  Alternative Solution
-  Excess Inventory Management